




THERE ARE NO LIMITED QUANTITY PROVISIONS FOR THIS MATERIAL

MODE OF TRANSPORT PROHIBITIONS: Ground shipping: **ALLOWED** | NO AIR OR VESSEL SHIPPING IS PERMITTED W/O WRITTEN AUTHORIZATION FROM LIIHAZMAT@LENNOXINTL.COM. IF WRITTEN AUTHORIZATION IS GIVEN, LIMITS ARE: Passenger aircraft/ rail: **FORBIDDEN** | Cargo aircraft: **ALLOWED 331 lb (150 kg) limit** | Vessel: **ALLOWED, Stowage Category D, 25, 40, and 57.**

MATERIALS OF TRADE EXCEPTION - MAY BE SOLD BY LENNOX STORES TO TRADESMEN IN QUANTITIES NOT TO EXCEED A TOTAL OF 220 POUNDS (100 KILOGRAMS) OF PRODUCT UNLESS tradesmen shows proof of commercial drivers license (CDL) with hazardous materials /dangerous goods endorsement. If tradesman has endorsed CDL, sales volume limits do not apply.

CONTAINER & PACKAGING REQUIREMENTS

- ① Use strong outer packaging appropriate for weight of contents (i.e. box must be rated for the maximum weight being placed in the box). If you cannot tell the weight rating of the box, please ask your supervisor and/or contact Lennox Environmental at liihazmat@lennoxintl.com or +1-972-497-7532.
- ② Protect valves from leaking or damage by wrapping, using a cap, or other protective devices. If for any reason, wrapping, caps and protective devices are not available or practical, exemptions may apply. Contact LIIHazmat@lennoxintl.com for a waiver.
- ③ Add separation materials to prevent damage to containers AND hold upright.
- ④ Cardboard packing box must have a PREPRINTED UN symbol on it, and a rating of 4GV/X5/S, 4GV/X7/S, or 4G/Y24.2/S. IF A BOX IS REQUIRED to ship this product. If you do not have a U/N certified box contact your supervisor, you may not use a non-U/N certified box to ship this product.
- ⑤ Box must be labeled with the Class 2 Flammable Gas Label on two opposite sides of box. NEVER PUT LABELS ON TOP OR BOTTOM OF BOX.
- ⑥ Place the Consigner (Shipper/From) / Consignee (Receiver/To) on box with weather resistant marking.
- ⑦ Orientation Arrow is essential IF boxed as must be shipped UPRIGHT.
- ⑧ Box must be marked with "UN1001" and "Acetylene, Dissolved" within 6 inches of labels in ⑤
- ⑨ If you are putting an inner package/box holding this product inside an outer box or on a pallet (i.e. using an 'overpack'), inner boxes MUST MEET THIS PACKING INSTRUCTION. AND, outer box or pallet shrink wrap MUST BE MARKED and LABELED with every marking/label used on the inner boxes if not visible through the overpack. **Outer box must have the OVERPACK marking.**

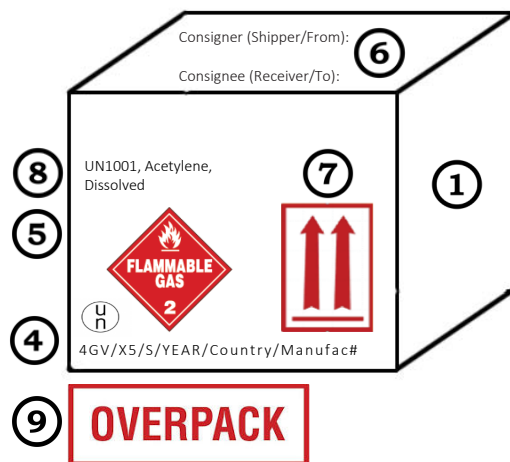

An 'overpack' is a container (box, shrink-wrapped pallet, etc.) used to consolidate individual containers in an easier to ship form.

IMPORTANT NOTE - IN THE HIGHLY UNLIKELY APPROVAL BY LIIHAZMAT@LENNOXINTL.COM OF SHIPPING THIS PRODUCT BY AIR - THE FOLLOWING LABEL MUST BE ADDED TO THE SAME SIDES OF THE BOX AS THE CLASS 2 LABEL PRIOR TO SHIPPING.



FOR QUESTIONS OR WAIVERS PLEASE CONTACT LIIHAZMAT@LENNOXINTL.COM

DO NOT SHIP UN1001 IN THE SAME VEHICLE WITH THESE CLASSES



DO NOT SHIP UN1001 WITHOUT SEPARATION IN THE VEHICLE WITH THESE CLASSES

